
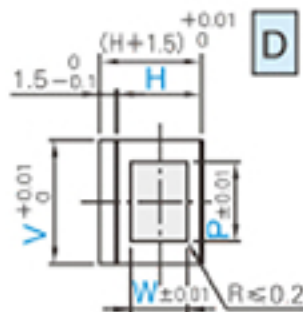
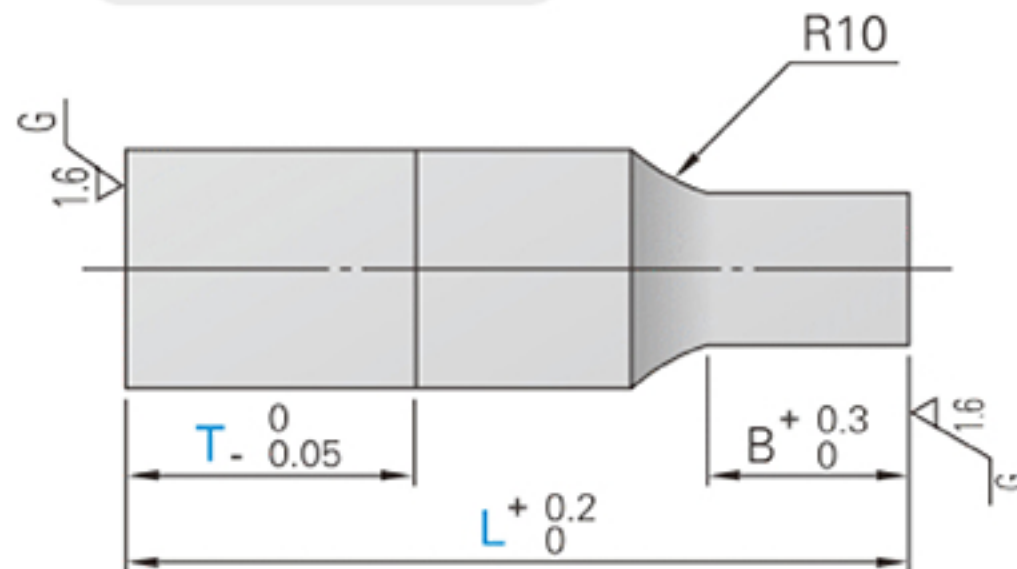


WHT
WHST
WPHT

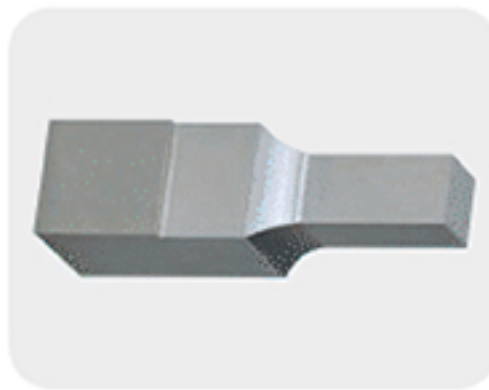

W≤P≤Wx20

可指定 R=0

W≤P≤Wx20

0.15≤R<W/2 0.01mm

P=V, W=H

W≤P≤Wx20

W<P≤Wx20

ex. Example



M	H		Type	Catalog No.	
					(B) (L>S)
SKD11	60~63HRC	H6~30	WHT	D R E G	S L
SKH51	61~64HRC	H3~ 5	WHST		
	64~67HRC	H6~28 H3~30	WPHT		



A		ORDER	Catalog No. - V - H - L - P - W - R($\text{\textcircled{R}}$)- T - TF														
			WPHTES - 08 - 08 - 60 - P6.00 - W4.00 - T20 - TF0														
B		ORDER	Catalog No. - V - H - L - P - W - R($\text{\textcircled{R}}$)- T - TF - X - Y														
			WPHTEL - 10 - 10 - 60 - P6.00 - W5.00 - T16 - TF0 - X0.00 - Y0.55														

Catalog No.			V	3	4	5	6	8	10	13	16	20	22	25	28	(30)	L	T	B	
Type			H	1.5	2.0	2.5	3.0	3.0	4.0	5.0	7.0	8.0	9.0	10.0	12.0	12.0			S	L
WHT WHST WPHT	D R E G	S	(3) 1.0	o	o	o	o	o	o	o	o	o	o	o	o	o	(40) (50) 60 70 80 90 100	13 16 20 22 25	6	8
			(4) 1.0		o	o	o	o	o	o	o	o	o	o	o	o			8	13
			5 1.2			o	o	o	o	o	o	o	o	o	o	o				
			6 1.5				o	o	o	o	o	o	o	o	o	o				
			8 2.0					o	o	o	o	o	o	o	o	o				
			10 2.5						o	o	o	o	o	o	o	o				
			13 3.0							o	o	o	o	o	o	o			13	19
			16 4.0								o	o	o	o	o	o				
			20 5.0									o	o	o	o	o				
			22 6.0										o	o	o	o				
			25 6.5											o	o	o			19	25
			28 7.0												o	o				
			(30) 7.5													o				

⚠ B ≤ L - (T + 15)

⚠ L(40) • H10~30 ----> B = 1

⚠ L(50) • H16~30 ----> B = 19

⚠ H(3) • (4) ----> L40~70

⚠ H(30)V(40) ----> WHT□□, WPHT□□



