


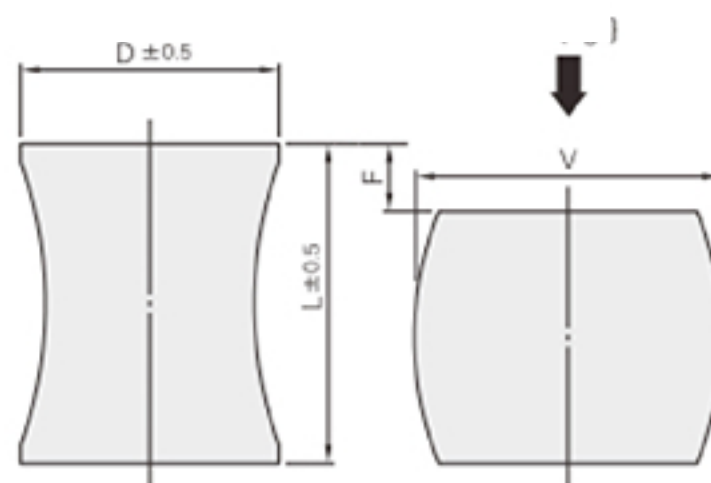

ORDER

 Catalog No.
 WEX 100100


A90

Catalog No.	F=L×20%		F=L×25%		F=L×30%			D	L
	F mm	N(KGF)	F mm	N(KGF)	F mm	N(KGF)	V		
WEX 5060	12	7551	15	9807	18	14710	58	50	62
WEX 5080	16	{ 770 }	20	{1000}	24	{1500}			82
WEX 6060	12	11082	15	15004	18	21575	70	60	62
WEX 6080	16	{1130}	20	{1530}	24	{2200}			82
WEX 8080	16	20104	20	27753	24	41188	92	80	82
WEX 80100	20	{2050}	25	{2830}	30	{4200}			103
WEX 10080	16		20		24				82
WEX 100100	20	29420	25	41188	30	61292	114	100	103
WEX 100120	24	{3000}	30	{4200}	36	{6250}			123

{kgf}= N×0.101972

