
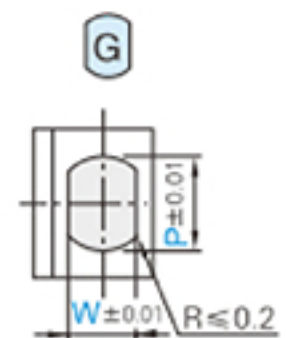
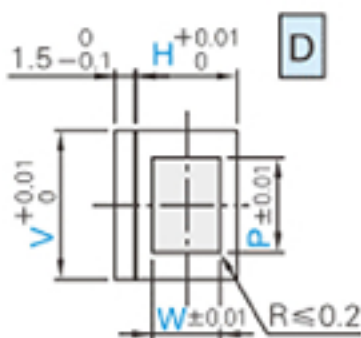


WHF
WHSF
WPHF

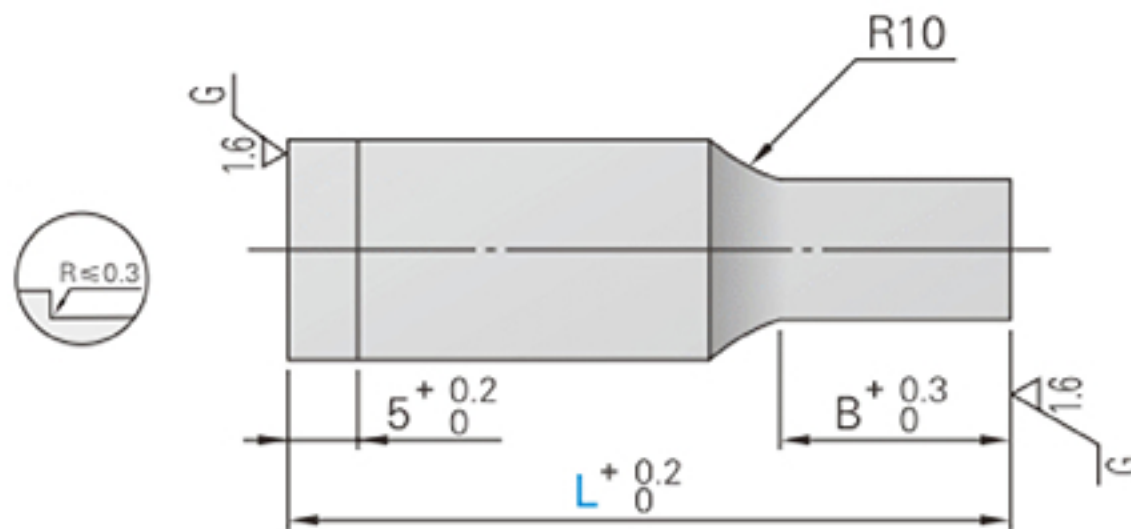

W ≤ P ≤ Wx20

R=0

W ≤ P ≤ Wx20

0.15 ≤ R < W/2 0.01mm

P=V, W=H


W ≤ P ≤ Wx20

W < P ≤ Wx20


M	H		Type	Catalog No.
				(B) (L>S)
SKD11	60~63HRC	H6~30	WHF	D R E G S L
SKH51	61~64HRC	H3~ 5	WHSF	
	64~67HRC	H6~30 H3~30	WPHF	



A

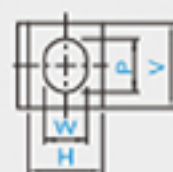

B

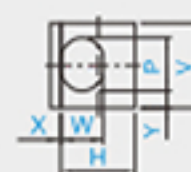

A	 ORDER	Catalog No. - V - H - L - P - W - R() - F									
		WPHFES - 08 - 08 - 60 - P6.00 - W4.00 - F0									
B	 ORDER	Catalog No. - V - H - L - P - W - R() - F - X - Y									
		WPHFEL - 10 - 10 - 60 - P6.00 - W5.00 - F0 - X0.00 - Y0.50									

Catalog No.			V	2	3	4	5	6	8	10	13	16	20	22	25	28	30	(40)	(50)	L	B	
Type			H	1.0	1.5	2.0	2.5	3.0	3.0	4.0	5.0	7.0	8.0	9.0	10.0	12.0	12.0	16.0	20.0	L		
WHF WHSF WPHF			(2) 1.0	o	o	o	o	o	o	o	o	o	o	o	o	o	o	o	o	(40) (50)	6	8
			(3) 1.0		o	o	o	o	o	o	o	o	o	o	o	o	o	o	o			
			(4) 1.0			o	o	o	o	o	o	o	o	o	o	o	o	o	o			
			5 1.2				o	o	o	o	o	o	o	o	o	o	o	o	o		8	13
			6 1.5					o	o	o	o	o	o	o	o	o	o	o	o			
			8 2.0						o	o	o	o	o	o	o	o	o	o	o			
			10 2.5							o	o	o	o	o	o	o	o	o	o	60	13	19
			13 3.0								o	o	o	o	o	o	o	o	o			
			16 4.0									o	o	o	o	o	o	o	o			
			20 5.0										o	o	o	o	o	o	o	80	19	25
			22 6.0											o	o	o	o	o	o			
			25 6.5												o	o	o	o	o			
			28 7.0													o	o	o	o	90	19	25
			30 7.5														o	o	o			

 L(40) • H10~30 B = 13
 L(50) • H16~30 B = 19
 H(2)(3)(4) L40~70
 V(40) • (50)

