

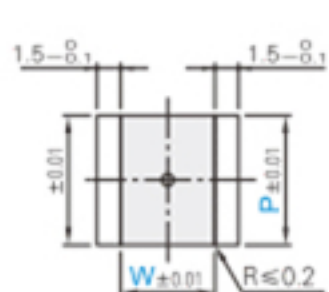
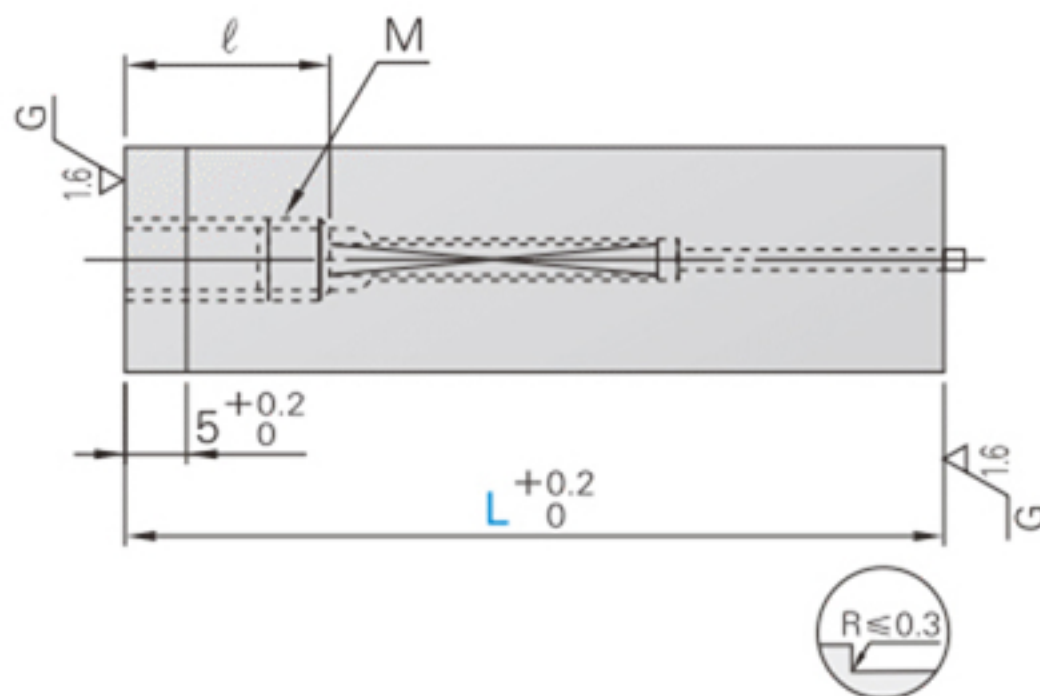



WHJWC
WWSJWC
WPHJWC

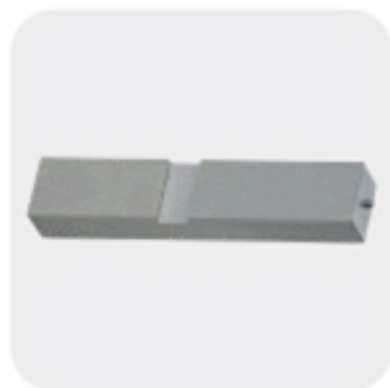


WsP
R=0
H=P

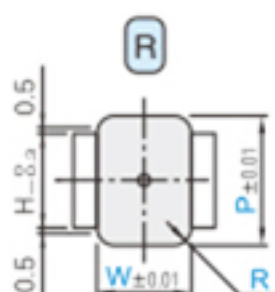

WsP
0.15 ≤ R < W/2
W-2R ≥ 1 0.01mm
2 ≤ P-2R-1
H=P-2R-1

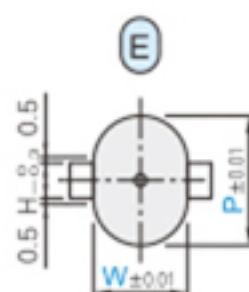

W < P
P ≤ 10 P-W ≥ 1
10 < P ≤ 20 P-W ≥ 2
20 < P ≤ 30 P-W ≥ 3
2 ≤ P-W-1
H=P-W-1

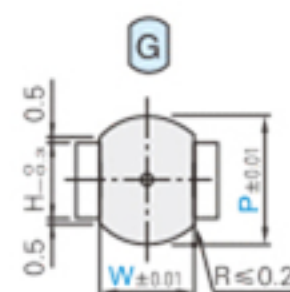

W < P
P ≤ 10 P-W ≥ 1
10 < P ≤ 20 P-W ≥ 2
20 < P ≤ 30 P-W ≥ 3
2 ≤ √(P-W) - 1
H=√(P-W) - 1

M	H	Type	Catalog No.
SKD11	60~63HRC	WHJWC	D R E G
SKH51	61~64HRC	WWSJWC	
	64~67HRC	WPHJWC	



ORDER	Catalog No.	L	P	W	R (R)	WF
	WHJWCD	80	P15.00	W7.25		WF0

Catalog No.		L	P	5.01	10.01	15.01	20.01	25.01	M	ℓ
Type				10.00	15.00	20.00	25.00	30.00		
WHJWC WWSJWC WPHJWC	D E R G	40	5.01~ 6.00	o	o	o	o	o	4	12
		50	6.01~ 8.00	o	o	o	o	o	5	
		60	8.01~10.00	o	o	o	o	o	6	
		70	10.01~15.00		o	o	o	o		
		70	15.01~20.00			o	o	o		
		80	20.01~25.00				o	o	8	

