



Angle pin I

AAPRWS

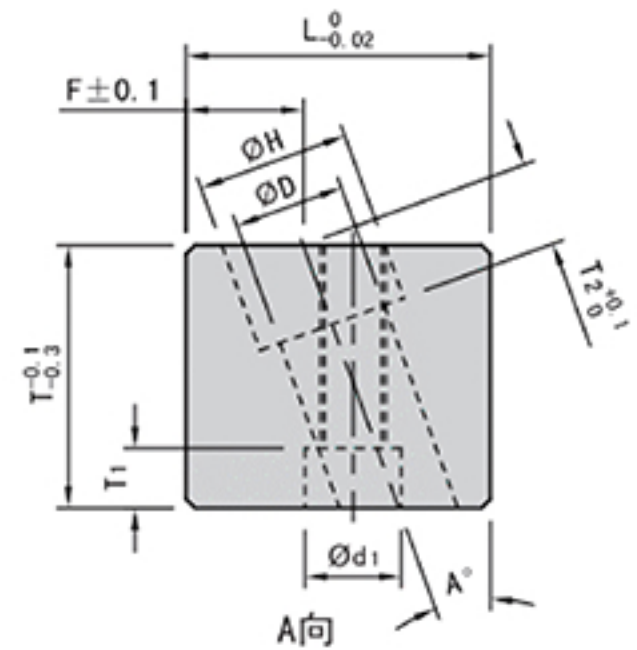

Order AAPRWS-D-T-A°

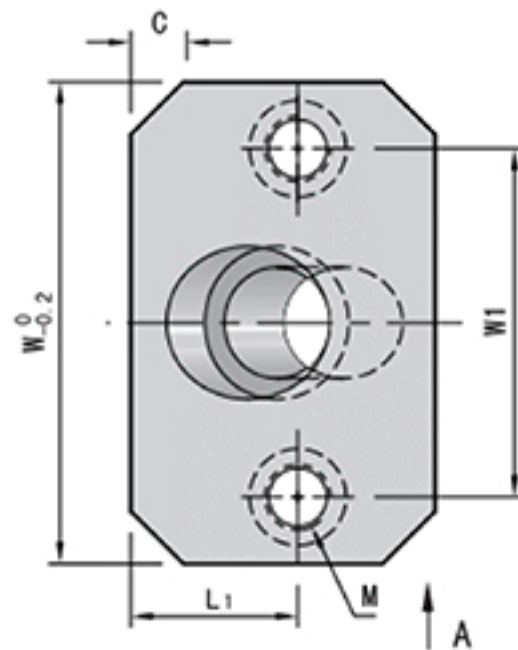

:S45C


A=10~20°

Code	D	DH7	W	W1	L	L1	H	T2
AAPRWS	8	8	+0.015 -0	38	24	24	12	5
	10	10	+0.018 -0	40	26	28	14	10
	13	13	+0.021 -0	44	30	34	17	13
	16	16		48	34	40	20	15
	20	20		58	40	45	24	
	25	25		65	46	55	29	
	30	30		75	54	65	36	

Code	D	d1	t1	F	C	M	Mounting screws	T	@ ¥/P
AAPRWS	8			8				20	25
	10			10				25	30
	13	11	7	12	3	8	M 6	30	35
	16			13				35	40
	20			15	5			40	45
	25	14	9	18		10	M 8	45	50
	30	18	11	22	10	12	M10	55	60



Installation Diagram:

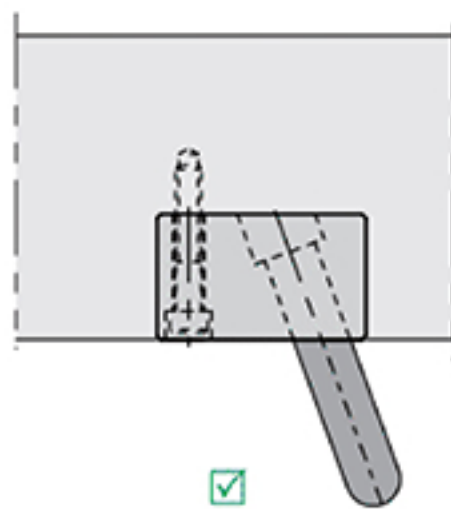

Note: Must installation by embedded

